


# NO MONUMENT SET

## MONUMENT RECORD

Corner ID: **CICr\_U23**


**Quarter Corner**

Sections 35 & 36- T07N-R01W, 2nd P.M.  
Clear Creek Township, Monroe County, Indiana

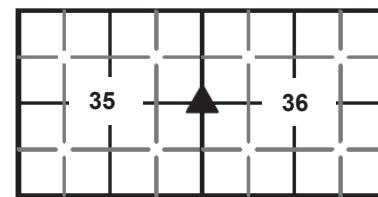

**MONUMENTATION:** The calculated location of this corner is in Monroe Lake, no monument was set.

### CORNER LOCATION SKETCH:

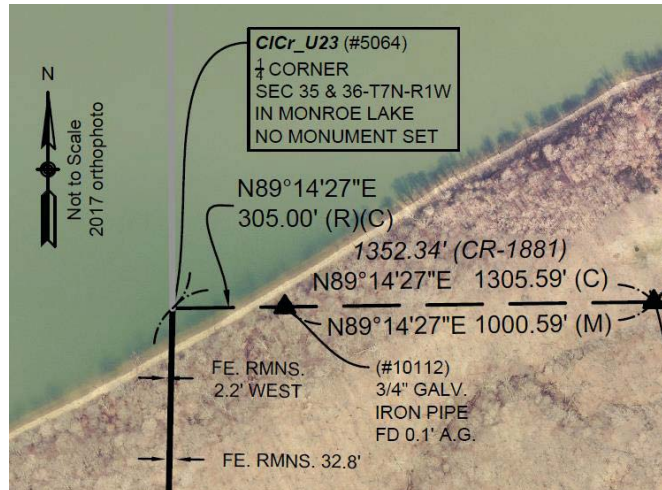

### GEODETIC COORDINATES:

Northing: 1366570.93', Easting: 3124216.76'

**BASIS OF GEODETIC COORDINATES:** The basis of bearings is Grid North System NAD83 (2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b\_conus.db3, US Survey Feet. Tied to NSRS using the JAVAD GNSS Data Online Processing Service (DPOS) to post-process static observations collected with a Javad Triumph 2 base. Positional values of this corner were determined from static GNSS and RTK GNSS (Javad Triumph LS Rover) observation.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 36-T7N-R1W by Rachel Oser of the Monroe County Surveyor's Office dated August 5, 2019 and recorded as Instrument Number 2019011075 in the office of the Monroe County Recorder.

**HISTORY AND SEARCH PROCEDURE:** The original GLO surveyor set a wooden post at this corner. This corner was referenced on several legal surveys on file in the Office of the Monroe County Surveyor, an 1860 legal survey by J.S. Buskirk on file in MCSO Survey Book 2, page 36 (Reference Survey ID 000049), an 1881 legal survey by M. Buskirk on file in MCSO Survey Book 2, page 350 (Reference Survey ID 000052), and a 1903 legal survey by Charles Bowers on file in MCSO Survey Book 2, page 588 (Reference Survey ID 000051). None of these surveys specifically describe the monument.

In 1987, Ed Farkas surveyed the 5.28-acre tract adjacent to Monroe Reservoir in the SW1/4 of the NW1/4 and the NW1/4 of the SW1/4 of Section 36 (Reference Survey ID000519). He called out an iron pipe on the fee line 305 feet east of the quarter corner. He also called out a rebar 352.71 feet east of the iron pipe. We found the rebar disturbed, and we found the iron pipe in good condition (#10112), in line with the remains of east/west fence. The iron pipe is shown as set on Segment "3" of the Monroe Reservoir Monumentation Maps on file in the Office of the Monroe County Surveyor. A stone was found 1000.59' east of the iron pipe at CICr\_V23, the Center-West 1/16 corner of Section 36 (#10108).

We calculated this corner 305' west of the iron pipe on the western extension of the line formed between the stone at CICr\_V23 (#10108) and the iron pipe (#10112). The remains of north/south fence were found on the south bank of the lake, 2.2' west of the line between the calculated location of this corner and the rebar found at CICr\_U25. The fence remains continued south up the hill and measured as far as 39' east of the line.

### CERTIFICATIONS:



Date: August 5, 2019  
Rachel Oser, State of Indiana  
PS No.21100022



Date: August 8, 2019  
Trohn Enright-Randolph  
Monroe County Surveyor



Accepted by the Monroe  
County Surveyor Review  
Board on August 6, 2019



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 1